

CVC Cable **Attachment**

VON DUPRIN


FOR DEVICES SOLD PRIOR TO 8-10-16

Installation Instructions


98/9949, 33/3549A

Install Cable(s).


a. Position red cable end to clip on center slide




slide shown)



c. Push cable snap against center slide to secure cable




d. In the same way, install opposite end of red cable to top latch in the position marked red




For 2-Point Latch Only


e. There is an adjuster on one end of the white cable. Install this end to the remaining top latch position (marked as white)

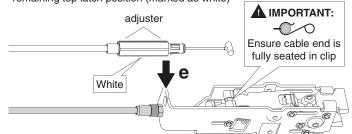

f. Install opposite end of white cable to bottom latch



Refer to Device Instructions to Complete Installation.

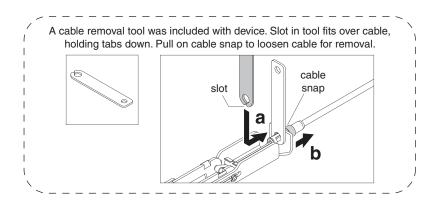

98/9949WDC

Cable A = Top Cable **Cable B** = Upper Bottom


Cable B = Upper Bottom Cable **Cable C** = Lower Bottom Cable

1 Install Top Latch Cable Assembly.


a. Using **Cable A**, position cable end to clip on center slide, and snap it into place



b. Push cable snap against center slide to secure cable




- Position opposite end of Cable A to the top latch in the position marked red. Pull cable into clip to snap it into place.
- d. Push cable snap against latch to secure cable




For 2-Point Latch Only

e. Snap cable link onto one end of Cable B




f. Install Cable B to the top mounting bracket

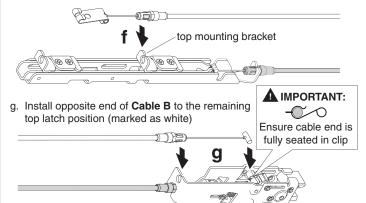


2 Install Bottom Latch Cable Assembly. For 2-Point Latch Only


One end of **Cable C** has an adjuster. Install this end to the bottom latch.

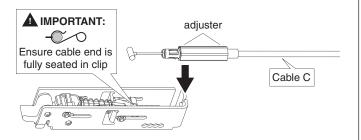


Temporarily Attach Bottom Latch Cable Assembly to Center Slide.


For 2-Point Latch Only

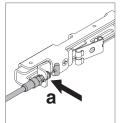





Push cable snap against mounting bracket to secure cable

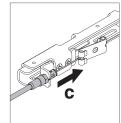

Pull on cable end to attach it to the cable link

Refer to Device Instructions to Complete Installation.

CABLE REMOVAL

A cable removal tool was included with device. Slot in tool fits over cable, holding tabs down. Pull on cable snap to loosen cable for removal.



